


快速接头 · 旋转接头

Quick Connectors · Rotary Joints




异径接插管



CAD 2D

材质: PBT

减径直通插头

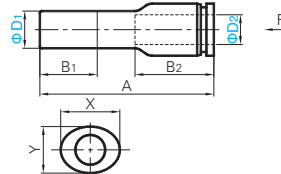

F视图

CAD 2D

材质: PBT

型式			B ₁	B ₂	A
型号	D ₁	D ₂			
KJIG	6	4	17	16	36
	8	4	18.5	18	39.5
	8	6		17	38.5
	10	6	22	19	44
	10	8	21	18.5	42.5
	12	8	24	20	47
	12	10	22	21	46.5
	16	12	24.8	22.5	54

型式			B ₁	B ₂	A	X	Y
型号	D ₁	D ₂					
KJGJ (黑色)	6	4	17	15.9	39.5	13.9	10.5
	8	4	18	18.2	41.5	15.9	
	8	6			41.6		
KJGJG (灰色)	10	6	20	21.2	46.6	19.5	12.5
	10	8			46.8		
	12	6	23.5	22.9	46.4	23	13.9
	12	8			46.8		
	12	10			52.2		



订货范例

Order

型式


KJIG6-4



5

个工作日

旋转接头
标准型

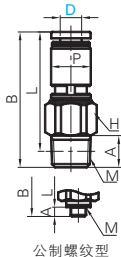


公制螺纹型

CAD 2D

型式	公称	螺纹尺寸	A	B	L	P	对边距离	容许转速	空转扭矩	有效截面积	重量
型号	D	M					H	(r.p.m)	(N · cm)	(mm ²)	(g)
RJS	4	M5	M5	3	32.6	29.6	10	12	500	0.6	1.9
		1	R1/8	8	34.1	30.1					3.6
		M5	M5	3	36.2	33.2					19
	6	1	R1/8	8	36.9	32.9	12.5	14	500	1.2	18
		2	R1/4	11	38.9	32.8					23
		M5	M5	3	36.2	33.2					19
	8	1	R1/8	8	45.3	41.3	14.5	17	400	1.5	34
		2	R1/4	11	44.3	38.3					32
		3	R3/8	12	44.3	38					39
	10	2	R1/4	11	58.8	52.8	17.8	22	300	2	74
		3	R3/8	12	56.8	50.5					70
		M5	M5	3	36.2	33.2					19

旋转接头
L型

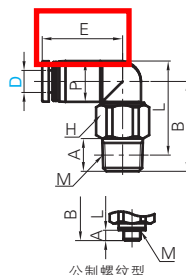

公制螺纹型


CAD 2D

型式	公称	螺纹尺寸	A	B	L	P	E	对边距离	容许转速	空转扭矩	有效截面积	重量
型号	D	M						H	(r.p.m)	(N · cm)	(mm ²)	(g)
RJSL	4	M5	M5	3	20.5	22.5	10	20	12	500	0.6	1.5
		1	R1/8	8	22	23						2.9
		M5	M5	3	23.3	26.5						20
	6	1	R1/8	8	24	26.2	13	23	14	500	1.2	19
		2	R1/4	11	26	26.2						24
		M5	M5	3	23.3	26.5						20
	8	1	R1/8	8	31.5	34.7	15	26	17	400	1.5	35
		2	R1/4	11	30.5	31.7						33
		3	R3/8	12	30.5	31.4						41
	10	2	R1/4	11	38.3	41	18	30	22	300	2	67
		3	R3/8	12	36.3	38.7						63
		M5	M5	3	23.3	26.5						20

① 空转扭矩是指未承受压缩空气的压力状态下回转所需的扭矩。

② 特长: 用于一般空压设备的摆动部位、回转部位配管用的快速接头。回转部位使用轴承, 所以适合于快速运动的摆动部位、高速回转部位。

结构图

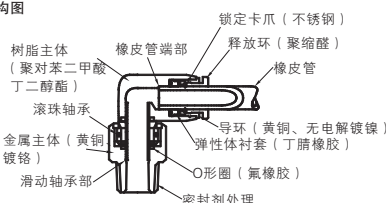

规格

使用流体	压缩空气
使用温度范围	0~60℃
最高使用压力	1.0MPa
使用真空压力	-100kPa



订货范例

Order

型式

RJSL4

公称型号

M5



5

个工作日